

FIELD INSPECTION

Project Name:	Mountain Valley Pipeline	Inspector:	Marshall Willis
Inspection Date:	Thursday, July 11, 2019	Project Contact:	Brian Clauto
Spread I: Franklin County	STA 14042+40 – 14062+17 STA 13840+00 – 13860+00 STA 14209+75 – 14249+19	Weather (Wet/Dry/Rain):	Dry

STAGE OF CONSTRUCTION: (Check all that apply)

- Clearing Rough Grading Trench Excavation Pipe Assembly, Testing & Installation
 Backfilling and Grade Restoration Final Grading & Stabilization Other: Dormant

- | | | Yes | No | N/A |
|---|---|-------------------------------------|-------------------------------------|--------------------------|
| 1 | Are controls installed and implemented in accordance with the approved erosion and sediment control plan and stormwater management plans? | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| 2 | Are all control measures properly maintained in effective operating condition in accordance with good engineering practices and, where applicable, manufacturer specifications? | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| 3 | Areas of offsite sediment deposition were observed? | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |

Comments: Inspected the following resources: S-YZ4, S-YZ5, S-C16, S-HH4, S-C20, S-C19 and S-F11.

- STA 14210+00 to 14213+75: Inadequate stabilization. Re-stabilize area and repair rill erosion.
- STA 14216+00 to 14223+41: Inadequate stabilization. Re-stabilize area and repair rill erosion.
- STA 14217+00: Maintain/clean out sump.
- STA 14217+00: Sediment off ROW.
- STA 14217+00: End treatment undermined. Repair end treatment.
- STA 14229+00: Maintain/clean out sump.
- MVP-MLV-AR-32: Repair secondary containment.

Recommended Corrective Action: Adequately re-stabilize ROW. Maintain and install all controls per the approved plan and specs.

Deadline: Within 24-hr notification

The recommended corrective action deadline date applies to all conditions noted on this report unless otherwise noted. If listed condition(s) currently constitute non-compliance and/or corrective actions are not completed by the deadline, other enforcement actions may be issued to the entity responsible for ensuring compliance on the above project.

Inspector Signature: 

Date: 07/11/2019

FIELD INSPECTION PHOTO LOG

Project Name: Mountain Valley Pipeline

Date: Thursday, July 11, 2019

Fig. 1: STA 14210+00 to 14213+75 – Inadequate stabilization. Repair rill erosion and stabilize.



Fig. 2: STA 14217+00 – Sediment off ROW.



Fig. 3: STA 14217+00 – End treatment undermined.



Fig. 4: STA 14217+00 – Sump maintenance needed.



FIELD INSPECTION PHOTO LOG

Project Name: Mountain Valley Pipeline

Date: Thursday, July 11, 2019

Fig. 5: **STA 14216+00 to 14223+41** – Inadequate stabilization. Repair rill erosion and stabilize.



Fig. 6: **STA 14229+00** – Sump maintenance needed.



Fig. 7: **MVP-MLV-AR-23** – Repair secondary containment structure.

