FIELD INSPECTION

Project Name:	**Mountain Valley Pipeline**	**Inspector:**	**Matthew Grant**
Inspection Date:	**Wednesday, August 7, 2019**	**Project Contact:**	**Cory Chalmers**
Spread: Montgomery County MP236-237 St12475-12543+56 AR278.01	**Spread H**	**Weather (Wet/Dry/Rain):**	**Dry**

STAGE OF CONSTRUCTION: (Check all that apply)

☐ Clearing ☐ Rough Grading ☐ Trench Excavation ☐ Pipe Assembly, Testing & Installation

☐ Backfilling and Grade Restoration ☐ Final Grading & Stabilization ☒ Other: Voluntary SW & SWO area

		Yes	No	N/A
1	Are controls installed and implemented in accordance with the approved erosion and sediment control plan and stormwater management plans?	☐	☒	☐
2	Are all control measures properly maintained in effective operating condition in accordance with good engineering practices and, where applicable, manufacturer specifications?	☐	☒	☐
3	Areas of offsite sediment deposition were observed?	☒	☐	☐

Comments:

- Inspected designated stream and wetlands included: S-CD12, WKL 58, S-IJ-19, S-EF54.
- The inspection conducted included the area between St12475 through St12482+67 and the area within the SWI St 12494+25 through12543+56. Areas within the SWI were actively being repaired, sediment removal was on going on designated streamS-IJ-19.
- Areas within St12475 and 12482+67 require stabilization.
- St12476+40 sump requires maintenance
- St12479+80 sump requires to be built to spec
- St 1248 bridge waddle requires replacement
- St1248+00 sump requires to be built to spec
- St 2481 stabilization of diversion near bins is required
- St12484 water bar requires maintenance
- Between St12529+64 through 12530+50 sediment is off ROW and sumps requires install per the spec.

Recommend Corrective Action: Maintain and install all controls per the approved plan and specs

Deadline: Within the 24hr notification

The recommended corrective action deadline date applies to all conditions noted on this report unless otherwise noted. If listed condition(s) currently constitute non-compliance and/or corrective actions are not completed by the deadline, other enforcement actions may be issued to the entity responsible for ensuring compliance on the above project.

Inspector Signature:___ ___ Date: _8-19-19

FIELD INSPECTION PHOTO LOG

Project Name: **Mountain Valley Pipeline** **Date:Wednesday, August 7, 2019**

- Fig. 1 Areas within St12475 and 12482+67 require stabilization.

- Fig. 2 St12476+40 sump requires maintenance

- Fig. 3. St12479+80 sump requires to be built to spec

- Fig. 4. St 1248 bridge waddle requires replacement

INSPECTION PHOTO LOG

Project Name: **Mountain Valley Pipeline** **Date:Wednesday, August 7, 2019**

- Fig. 5 St1248+00 sump requires to be built to spec

- Fig. 6 St 2481 stabilization of diversion near bins is required

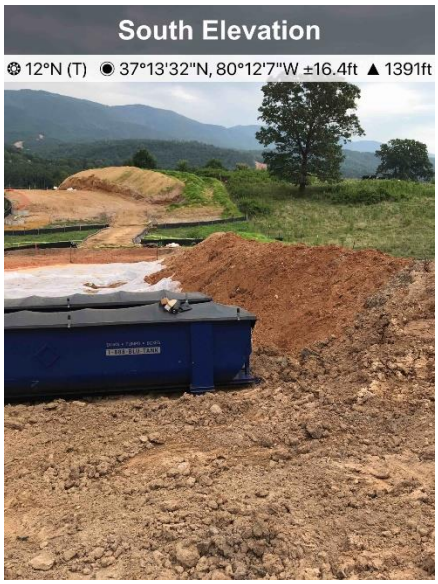

- Fig. 7. St12484 water bar requires maintenance

- Fig. 8. Ongoing repairs near and on designated stream S-IJ 19.

Project Name: **Mountain Valley Pipeline** **Date:Wednesday, August 7, 2019**

- Fig. 9 Sediment off ROW at St12529+64

- Fig. 10 Between St12529+64 through 12530+50 sediment is off ROW and sumps requires install per the spec.

- Fig. 11 Near CWD and slope drains at St 12534+37
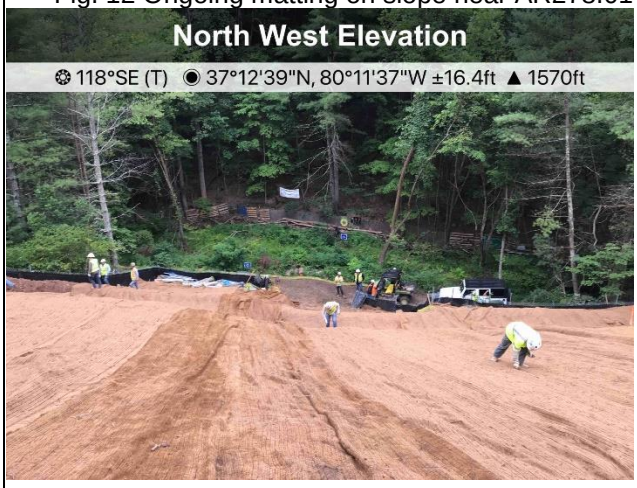
- Fig. 12 Ongoing matting on slope near AR278.01